

HAMILTON, NEW YORK

AL-5788 (FAA)

18032


APP CRS	Rwy Idg	<b>5014</b>
<b>155°</b>	TDZE	<b>1137</b>
	Apt Elev	<b>1137</b>

# RNAV (GPS) Y RWY 17



HAMILTON MUNI (VGC)

<b>NA</b>	DME/DME RNP-0.3 NA. Helicopter visibility reduction below 3/4 SM NA. When local altimeter setting not received, use Syracuse altimeter setting and increase all MDA 180 feet.	MISSED APPROACH: Climb to 4000 direct ZUNAV and right turn on track 249° to PITCH and right turn on track 343° to GGT VORTAC and hold.
-----------	---	--


AWOS-3P <b>119.425</b>	SYRACUSE APP CON <b>126.125 269.125</b>	UNICOM <b>123.0</b> (CTAF)	<b>122.7</b> <b>0</b>
---------------------------	--	-------------------------------	-----------------------

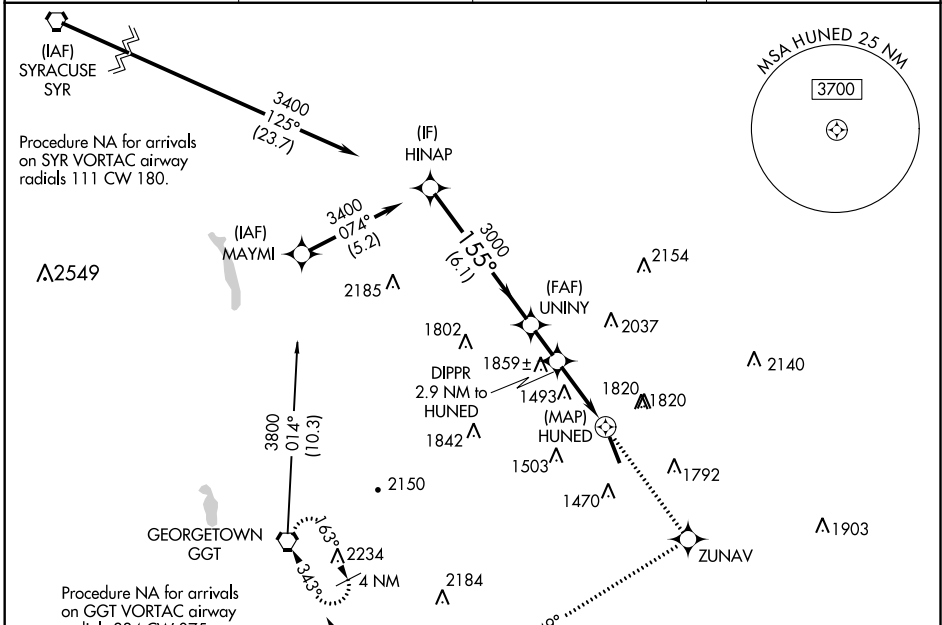

ELEV 1137	<b>D</b> TDZE 1137
-----------	--------------------

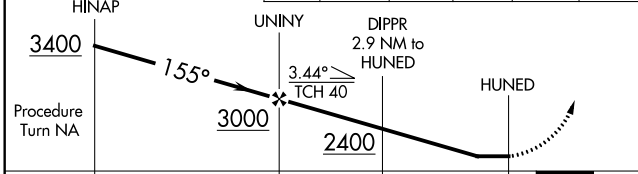

CATEGORY	A	B	C	D
LNVA MDA	2120-1 1/4 983 (1000-1 1/4)	2120-1 1/2 983 (1000-1 1/2)	2120-3 983 (1000-3)	NA
CIRCLING	2120-1 1/4 983 (1000-1 1/4)	2120-1 1/2 983 (1000-1 1/2)	2120-3 983 (1000-3)	NA

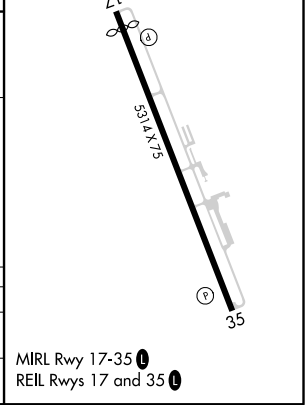

HAMILTON, NEW YORK  
Orig-A 30APR15

42°51'N - 75°34'W

# RNAV (GPS) Y RWY 17

NE-2, 06 DEC 2018 to 03 JAN 2019

NE-2, 06 DEC 2018 to 03 JAN 2019