

HAMILTON, NEW YORK

AL-5788 (FAA)

15288

APP CRS	Rwy Idg	5014
155°	TDZE	1137
	Apt Elev	1137

RNAV (GPS) Y RWY 17

HAMILTON MUNI (VGC)


▼ DME/DME RNP-0.3 NA. Helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Syracuse altimeter setting and increase all MDA 180 feet.

▲ NA

⊗ -25°C/-13°F

MISSED APPROACH: Climb to 4000 direct ZUNAV and right turn on track 249° to PITCH and right turn on track 343° to GGT VORTAC and hold.

AWOS-3P 119.425	SYRACUSE APP CON 126.125 269.125	UNICOM 123.0 (CTAF)	122.7 Ⓚ
---------------------------	--	-------------------------------	-----------------------


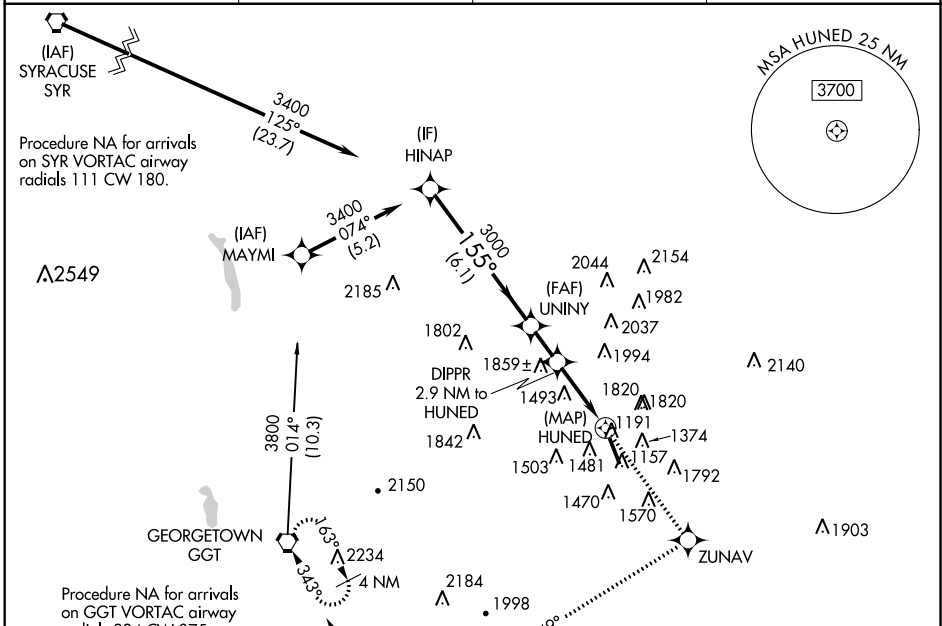


NE-2, 22 JUN 2017 to 20 JUL 2017


NE-2, 22 JUN 2017 to 20 JUL 2017

ELEV 1137	D TDZE 1137
-----------	--------------------

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 40).

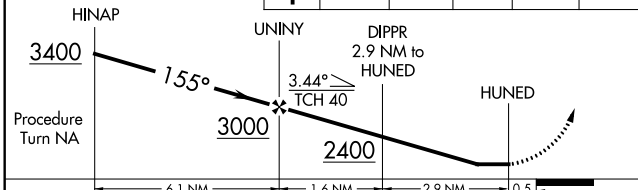

CATEGORY	A	B	C	D
LNVA MDA	2120-1¼ 983 (1000-1¼)	2120-1½ 983 (1000-1½)	2120-3 983 (1000-3)	NA
CIRCLING	2120-1¼ 983 (1000-1¼)	2120-1½ 983 (1000-1½)	2120-3 983 (1000-3)	NA

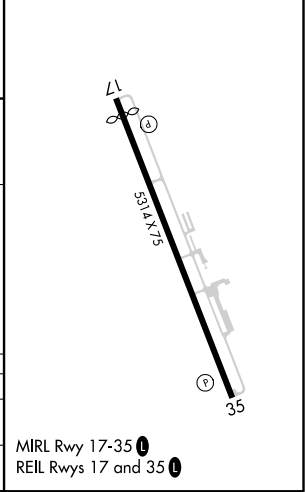

HAMILTON, NEW YORK
Orig-A 30APR15

42°51'N - 75°34'W

RNAV (GPS) Y RWY 17

HAMILTON MUNI (VGC)